

This report shows all the responses to the Fire Risk Assessment survey, including raised tasks.

Asset ID: 9590 1-40 Shepherdson Court Block 1-40 Shepherdson Court, Middlesbrough

Cover Sheet

Photo



Date of Fire Risk Assessment Date of Next Fire Risk Assessment FRA Frequency (Months) Purpose of Fire Risk Assessment Type of Fire Risk Assessment Fire & Safety Assessor 03 Apr 2025 03 Apr 2026 12 Annual Re-Assessment Type 1 (Common Parts Only - Non Destructive) Kevin Jones GIFireE.Tech IOSH

It is sensible to have arrangements in place to ensure the consistency of Fire Risk Assessments in terms of the assessment of risk and mitigations proposed. In this regard Accent peer validate around 20% of reports, which are available within our audit system.

The Scheme

Scheme Name	Shepherdson Court
Scheme Address	1-40 Shepherdson Court Block 1-40 Shepherdson Court, Middlesbrough
Postcode	TS6 6XF
Region	North East
Scheme Manager	
Scheme Tel. No	
Scheme Inspection Completed	Yes
Enforcing Fire Authority	Cleveland
Other staff in attendance	None
Number of on-site Accent staff	Scheme Manager Weekdays
Number of other (non-Accent) staff	Contract Cleaners in common areas

The Building

Accommodation Type	CAT2 Housing for Older People (S28)
Build Date	Jan 1 1983
Number Of Homes	39
Homes breakdown	Flat
External wall construction	Facing Brick
External wall finish	Facing Brick
Roof construction	Timber
Roof covering	Interlocking Pitched
PEEPs in place where necessary	Yes
Current Evacuation Strategy	Stay Put (Delayed) Evacuation
Conversion or purpose-built	Purpose Built
Number of storeys	2
Number of floors on which car parking is provided	1
Is there a habitable basement?	No
Number of internal Staircases (protected or unprotected?)	3 protected
Number of External Staircases	0
External Balcony part of escape route?	No
Unusual features	None
Building Access Conditions for Fire Brigade	Vehicular Access to one or more elevations

MIS-AMS ActiveH - Fire Risk Assessment Report

Fire Detection and Warning System	Flats and common areas not linked
Grade of fire alarm	Grade A
Category of fire alarm	LD1 Maximum Protection
Emergency Lighting Provision	Non Maintained System - Common Areas
Portable Fire Extinguishers supplied/fitted	Yes
Fixed Fire Fighting Installations	No

Customers

Asset ID: 9590

Number of occupants	45
Occupant tenure type breakdown	CAT2 Housing for Older People, Shared Ownership,
	Sheltered Schemes

Fire Safety Related Customer Safety Servicing

Overdue communal gas safety checks	0
Overdue domestic gas safety checks	0
Overdue communal electrical condition checks	0
Overdue domestic electrical condition checks	0
Overdue alarm call pull chord tests	0
Overdue communal PAT testing	0
Overdue customer mobility scooter PAT testing	0
Overdue Monthly Emergency Lighting Switch Tests	0
Overdue Annual Emergency Lighting tests	0
Overdue Weekly Fire Alarm Testing	0
Overdue Fire Panel - Six Monthly Testing	1
Overdue Fire Safety Equipment tests	1
Building Fire Safety Surveys - Communal Doors	
Failing Communal Fire Doors	0
Communal Fire doors due for replacement within 5 years	0

Dwelling Doors


Failing Dwelling Fire Doors	0
Dwelling Fire doors due for replacement within 5 years	0

Fire Risk Assessment Survey Results

Scheme and Building Information

Photo

Date of Fire Risk Assessment
FRA Frequency (Months)
Purpose of Fire Risk Assessment
Type of Risk Assessment
Quantity
Fire & Safety Assessor
Enforcing Fire Authority
Scheme Tel. No
Other staff in attendance
Number of on-site Accent staff
Number of other (non-Accent) staff
Scheme Inspection completed
Number of occupants
Personal Emergency Evacuation Plans in place
Current Evacuation Strategy
Conversion or purpose-built
Number of Storeys
Number of floors on which car parking is provided
Is there a habitable basement?
No. of internal staircases (protected/unprotected)
Number of external staircases
External balcony part of escape route?
Unusual features

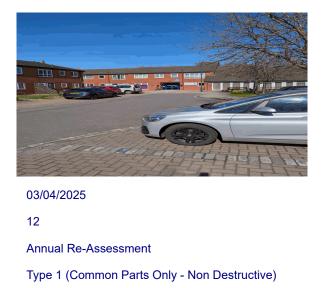

Kevin Jones GIFireE.Tech IOSH

Cleveland

None

None

1

Scheme Manager Weekdays Contract Cleaners in common areas Yes 45 Yes Stay Put (Delayed) Evacuation Purpose Built 2 1 No 3 protected 0 No

Fire Risk Assessment Survey Results

Building access conditions for Fire Brigade	Vehicular Access to one or more elevations
Surroundings: Residential/Commercial	Residential
Fire Detection and Warning System	Flats and common areas not linked
Grade of Fire Alarm	Grade A
Category of Fire Alarm	LD1 Maximum Protection
Emergency Lighting Provision	Non Maintained System - Common Areas
Portable Fire Extinguishers / Fire Blankets supplied / fitted	Yes
Water Extinguisher(s) present	Yes
Foam Extinguisher(s) present	No
Dry Powder Extinguisher(s) present	No
Carbon Dioxide Extinguisher(s) present	Yes
Fire Blanket(s) present	Yes
Fixed Fire Fighting Installations supplied / fitted	No
Dry Riser(s) present	No
Wet Riser(s) present	No
Sprinkler System present	No
Hosereel(s) present	No
Automatic Opening Vent(s) present	No

Electrical Sources of Ignition

Electrical installation within common areas in good condition and no obvious damage? Comment	Yes Appears to be in good condition and secured
Valid Electrical Installation Condition Reports held on file? (Common Areas & General Needs Flats)	Yes
Comment	Inspected on 17/06/2021
Electrical App/PA Testing - tested within past 12 months?	Yes
Comment	Inspected on 23/05/2024
Absence of trailing leads and adapters?	Yes
Comment	No leads identified during inspection
Evidence that mobility scooters are not being stored/charged in common areas? Comment	No
Is there a purpose built mobility scooter store/charging area?	No

Comment

Asset ID: 9590

Does the building have a lightning protection system?

Comment

Gas installations

Is there a commercial/domestic gas supply to the scheme?
Comment
Valid LGSR held on file for fixed communal area gas appliances? (Boilers) Comment
Valid LGSR held on file for residential flats that contains gas appliances? Comment
Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results
Comment

. . .

No

Not required for thuis property height

Yes Communal gas supply only for heating boilers Yes Inspected 21/10/2024 N/A Service not required communal supply only Yes

Other Sources of Ignition

Is there a no smoking policy in place, which is enforced and adhered to?	Yes
Comment	Communal areas only customers permitted to smoke within flats
Adequate security against arson?	Yes
Comment	Code entry system, CCTV secured and alarmed exit doors
Are refuse/recycling bin areas managed and suitably located?	Yes
Comment	2 designated refuse storage areas
Are there communal cooking facilities at this scheme?	Yes
Comment	Small kitchen for warming food and hot drinks, managed entrance and use by SHP
Are reasonable measures taken to prevent fires as a result of cooking?	Yes
Comment	Well mainrtained and clean kitchen work areas
Where there is extraction in communal kitchens, are filters and ductwork changed/cleaned regularly?	Yes
Comment	Expelaiur appears clean and in working order.
Housekeeping	

Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and and residents personal items?

Comment

Asset ID: 9590

Are unnecessary accumulations of combustible materials or waste avoided?

Comment

Are combustible materials and substances separated from ignition sources and stored appropriately?

Comment

Furniture/furnishings in good condition, fire retardant/resistant and comply with modern standards and regulations? Comment

Other Significant Fire Hazards

Are all other significant fire hazards adequately controlled?	Yes
Comment	Good houskeeping observed throughout premis
	during inspection

Means of Escape from Fire

Is it considered that the building is provided with reasonable means of escape in case of fire?	Yes
Comment	Clear means of escape
Escape routes unobstructed and safe to use?	Yes
Comment	Sterile corridors and means of escape observed during inspection.
Exits immediately openable without a key and/or failsafe's function correctly?	Yes
Comment	Push button and thumbturn operated final exit doors
Reasonable distances of travel where there is a single/alternative direction of travel?	Yes
Comment	Mininal travel distances observed
Escape routes lead to final exits and open in direction of escape where necessary?	Yes

Comment

Clear cupboards with no storage identified during inspection

Yes

Yes

All storage cupboardds well managed and tidy.

Yes

Sample inspection carried out and furniture appears to meet correct standards

during inspection

Asset ID: 9590


1-40 Shepherdson Court Block 1-40 Shepherdson Court, Middlesbrough

Observation
Obscivation

Clear Means of escape

Priority No Action



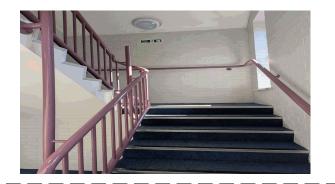

Required By:

Required By:

Task ID

Task ID

Referred To

Referred To

Observation

Priority No Action

Final exit door secure and fitted with push button handle



Fire Spread and Development

Is it considered that the compartmentation is of a reasonable standard?

Comment

Is there reasonable limitation of surface finishes that might promote fire spread (walls, floors, ceilings)?

Comment

Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products? Comment

As far as can be reasonably ascertained, is the compartmentation within roof spaces of a satisfactory standard?

Comment

Loft hatches fire resisting?

Comment

As far as can be reasonably ascertained, is the fire stopping above cross corridor fire doors within suspended ceiling void of a satisfactory standard?

Yes

Limited access to inspect above ceilings.Plaster ceilings with secured inspection hatchs. Yes

Plaster finish to walls and ceilings, concrete floors.

Yes

Kitchen shutter inoperative default to closed perminantly.

N/A

No access to lost areas available.

Yes

Loft hatch to Lift room 1 hour protection

Asset ID: 9590 1-40 Shepherdson Court Block 1-40 Shepherdson Court, Middlesbrough

Observation	Priority	Referred To	Required By:	Task ID
Comment		Kitchen shutter inopera perminantly.	tive default to closed	
Are roller shutter doors that are required to be FR, f self-closing?	ire resisting and	No		
Comment		None supplied		
If Smoke Control Systems (AOV's) are fitted, are the testing available?	e records of annual	N/A		
Comment		Traditional construction roof	brick and morter with	ı tiles
Do external walls, doors, windows and anything atta exterior, limit fire spread?	ached to the	Yes		
Comment		Limited access to inspe ceilings with secured in	•	ster

No Action

Dedicated refuse area

Observation	Priority	Referred To	Required By:	Task ID
Kitchen shutter remains closed due to fault	Internal - Medium	Project Manager		
		(Building Safety)		



Emergency Escape Lighting

Is the emergency lighting correctly specified and instal current standards?	lled as per	Yes
Comment		Appears to be installed to the correct standard
Emergency lighting units in good condition and secure walls/ceilings?	ly fixed to	Yes
Comment		All appear to be in good condition and secured
MIS-AMS ActiveH - Fire Risk Assessment Report	Page 9 of 16	Generated 03/04/2025 16:02:33

Records of monthly/annual testing available?

Comment

Asset ID: 9590

γ	60	
	00	

Last inspected annual 21/09/2024 Monthly 07/03/2025

 Observation
 Priority
 Referred To
 Required By:
 Task ID

 Lighting in good condition and secured
 No Action





Fire Safety Signs and Notices

Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas?	Yes
Comment	Correctly positioned throughout the scheme
Directional fire escape signage in place and adequate?	Yes
Comment	Correctly positioned
Is there suitable LIFT signage i.e. do not use in case of fire?	Yes
Comment	Positioned on both floors
Do common area fire doors display the correct signage on both sides where applicable?	Yes
Comment	

Observation	Priority	Referred To	Required By:	Task ID
Correctly positioned signage	No Action			





Means of giving Warning in case of Fire

Is the scheme fitted with a communal area fire alarm?

Asset ID: 9590 1-40 Shepherdson Court Block 1-40 Shepherdson Court, Middlesbrough

Comment	
Is fire detection and warning system appropriate for occupancy and fire risk, as per BS 5839-1:2017? Comment	Yes
Is the fire detection and warning system maintained/tested and all certificates saved on file?	Yes
Comment	Last tested 05/09/2024
Fire alarm components in good condition and securely fixed to walls/ceilings?	Yes
Comment	All appear in good condition and secured
Hold open devices operate at the sounding of the alarm and are in a serviceable condition?	Yes
Comment	Periodialy tested by SHP no issues reported
Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry? Comment	Yes
Is the fire alarm panel remotely monitored, and if so are there records of	Yes
regular testing?	
Comment	Last inspection 05/09/2024

Fire Extinguishing Equipment

Is fire extinguishing equipment and/or fixed fire fighting installations provided at this scheme? Comment	Yes tested 16/07/2024
Pertable fire extinguishere concentrate type/number/negitien?	Yes
Portable fire extinguishers - appropriate type/number/position?	165
Comment	
Correct signage displayed by each fire extinguisher?	Yes
Comment	
Fire blanket in communal kitchen, secured to the wall, complete with signage? Comment	Yes
Dry risers - Inlet/outlet boxes secured and/or securing straps fitted to outlet valves?	N/A
Comment	None fitted in scheme
Records available of fire fighting equipment servicing within past 12 months?	Yes

Comment

Referred To

Required By:

Task ID

Observation	Priority

Correcly positioned and signed extinguisher equipment

No Action



Management of Fire Safety

Asset ID: 9590

Are these premises regulated by the Building Safety Regulator under the Building Safety Act? Comment	Νο
Are there other Responsible Persons who share or have fire safety duties in respect of the premises?	Νο
How will this sharing be achieved?	
Is an office or IL scheme being inspected?	Yes
Comment	Small office used only bY SHP
IL Schemes & Regional Offices - Are there sufficient numbers of qualified Fire wardens?	N/A
Comment	Single use by SHP
Offices - Are there suitable arrangements for ensuring the premises are evacuated? Comment	Yes
Offices - Are there suitable arrangements for evacuating disabled people? Comment	N/A
Offices - Suitable arrangements for meeting the fire service on arrival and proving relevant information? Comment	Yes
Offices/IL Schemes - Is there a suitable assembly point?	Yes
Comment	Car park to the front of scheme
Offices - Are fire drills carried out at appropriate intervals?	N/A
Comment	All Accent staff recieve periodical Fire awareness training.

Passenger Lift

Asset ID: 9590 1-40 Shepherdson Court Block 1-40 Shepherdson Court, Middlesbrough

Is the scheme fitted with a passenger lift?	Yes
Comment	
Is the lift in full working order at the time of the FRA?	Yes
Comment	Operated during inspection, interior light broken repair requested and warnong signs posted on lift door.
Is the lift fitted with a firefighters switch?	No
Comment	
Servicing and insurance inspection - Evidence of regular servicing/maintenance?	Yes
Comment	Last inspected 07/03/2025

Premises Inspection Box

Is there a premises information box for fire & rescue service use?	Yes
Comment	
Are there arrangements to check the premises information box is kept up to date?	Yes
Comment	SHP updtaes regularly.

Evacuation Policy

Are there suitable arrangements for summoning the fire service?	Yes
Comment	999 telephone call from SHP or customers
Taking FRA findings, is the evacuation policy appropriate for the scheme as per latest guidance?	Yes
Comment	ILS

Engagement with Residents

Has information of fire procedures been disseminated to residents?	Yes
Comment	Induction programme, Customer portal, news letter
Is general fire safety information disseminated to residents?	Yes
Comment	Induction programme, Customer portal, news letter

FRA Frequency

Taking the findings of this assessment into account, is the frequency of the FRA correct?

Comment

Miscellaneous

Are there any other observations/actions to raise that are not covered above.	No
Are there fire related remedial works required at this property, that will affect the fabric of the building?	Yes
Comment	flat door remidials , Kitchen shutter repair
Can work be conducted without the need for an asbestos survey. If no, task Customer Safety Surveyor - Asbestos.	Yes
Comment	
Were there any unsatisfactory aspects of the Fire Risk Assessment? (Visible on Building Safety Report).	Yes
Some fire doors did not fully close so works orders have been raised with our contractors.	Yes
Some minor works were required which have been raised with our contractors.	Yes
Unauthorised items were found in communal areas and arrangements were made for their removal.	No
Not all records were up to date, as noted in the table below. Arrangements have been made for these to be completed.	No
A number of fire doors were found to be wedged or propped open. Fire doors are there to keep you safe and me kept shut at all times.	No

Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

LOW	X	MEDIUM	НІGН	
-----	---	--------	------	--

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

MINOR	MAJOR	X	CRITICAL	
	J			

The definition of the above terms is as follows: *FRA Review Frequency*

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs).
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities.
CRITICAL	There is significant potential for serious injury or death of one or more occupants.

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trival	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	intolerable

When the level of risk is established, the action level can be read from the table below:

Asset ID: 9590

1-40 Shepherdson Court Block 1-40 Shepherdson Court, Middlesbrough

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is taken.
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

The Overall Risk Level for this asset is:	Trivial	