



ACCENT HOUSING - FIRE RISK ASSESSMENT



Region :	North West
Scheme Name :	Moss Side A - Manor House Close
Scheme Address :	Cheetham Meadow Leyland PR26 7UB
Date of Assessment:	05/03/2026
Date of Next Assessment:	05/03/2027
FRA Frequency:	Annual Re-Assessment under the Regulatory Reform (Fire Safety) Order 2005
Fire & Safety Assessor	Ian Potter FIFireE DipFD

This Fire Risk Assessment has been conducted upon the instruction of Accent Housing.

Scheme Details		Moss Side A - Manor House Close
Region:		North West
Scheme Name:		Moss Side A - Manor House Close
Site Address:	Street:	Cheetham Meadow
	Town:	Leyland
	Post Code:	PR26 7UB
Block & Asset No.		Block 25a-f Asset 9210
Date of this Assessment		05/03/2026
Date of Next Review		05/03/2027
Fire Risk Assessment Frequency		Annual
Purpose of Fire Risk Assessment		Annual Re-Assessment under the Regulatory Reform (Fire Safety) Order 2005
Fire & Safety Assessor		Ian Potter FIFireE DipFD
Director of Customer Experience		John Place
Housing Partner Manager		Jamie Trotter
Contract Manager		Karen Anthony
Scheme Manager/Customer Partner		Mandy Clarke
Other staff in attendance		None
Use of Building		General Needs living Sleeping accommodation
Approximate Number of occupants		Up to 12
Occupancy Profile		Mixed
Familiarity of the occupants		Fully Familiar
Likely state of the Occupants		Sleeping Familiar
PEEPs in place where necessary		N/A
Number of on-site Accent staff		None
Number of other (non-Accent) staff		Contract cleaners in common areas
Support Agency (Supported Housing)		N/A
Current Evacuation Strategy.		Stay Put (Stay Safe) Evacuation
Evidence that residents have been notified of the evacuation procedure		Fire Evacuation notices displayed in common areas and in place
History of fires in the building		None
Scope of Assessment		Type 1 (Common Parts Only - Non Destructive)
Applicable Fire Safety Guidance		Purpose-built flats guide

Building Details	Moss Side A - Manor House Close
Construction Date	1979
Construction Type	Concrete Frame
Roof Finish	Pitched-Concrete Tile
External Wall Finish	Brick
Are there any areas of external wall cladding	No
Are there any balconies	No
Conversion or purpose-built	Purpose Built
Number of flats (self-contained)/rooms (HMOS, shared houses)	6
Number of storeys above ground Not including Basements	Three
Number of storeys below ground	None
Is there a habitable basement?	No
Number of internal Staircases per Block (protected or unprotected?)	One-Protected
Number of External Staircases per Block	None
External Balcony part of escape route?	No
Unusual features	None
Building complexity	Simple
Building Access Conditions for Fire Brigade	Vehicular Access to one or more elevations
Surroundings: Residential/Commercial	Residential
Fire Provision Currently in Place	
Fire Detection and Warning System	Flats only
Grade of fire alarm (Flats)	Grade D
Category of fire alarm (Flats)	LD3 Minimum Protection
Grade of fire alarm (Communal)	None
Category of fire alarm (Communal)	None
Additional Comments:	
Evacuation Alert System (EAS)	Not Fitted
Additional Comments:	
Emergency Lighting Provision Additional Comments:	Non Maintained System Common Areas
Portable Fire Extinguishers Additional Comments:	None fitted
Fixed Fire Fighting Installations Additional Comments:	None fitted

Significant Findings - Fire						
Moss Side A - Manor House Close				05/03/2026		
Action Ref:	Potential Area of Fire Risk	Yes-No-N/A	Observation/Comments/ Actions Required	Risk Rating	Target Completion Date	Referred To:
Fire Hazards						
1	Electrical Sources of Ignition:					
1.1	Electrical Installation within common areas (Fixed Wiring, sockets, switches, light fittings) in good condition and no obvious damage	Yes	All common area sockets and fittings in a satisfactory condition at the time of inspection	.		
1.2	Valid Electrical Installation Condition Reports held on file.(Common Areas)	Yes	Valid communal area EIC Reports uploaded to property file all In date at time of inspection Last Inspection Date 20th Jul 23 Satisfactory	.		
1.3	Valid Electrical Installation Condition Reports held on file. (General Needs Flats)	Yes	Valid General Needs flats EIC Reports uploaded to M-Files and ActiveH. All checked and in date Satisfactory.	.		
1.4	Electrical App/PA Testing - all portable appliances tested within past 12 months	N/A	There are no portable appliances within the communal area.	.		
1.5	Absence of trailing leads and adapters	Yes	None within the communal areas	.		
1.6	Mobility Scooters - Stored/charged in common areas, purpose built store/resident flat	N/A	No evidence or reports that any of the residents own a mobility scooter	.		
2	Smoking:					
2.1	Are there any risks associated with smoking in the building?	No	Smoking is not allowed within the communal areas. Smoking is only permitted within flats. There are smoking signs present within the communal areas.	.		
3	Arson:					

3.1	Adequate security against arson?	Yes	Front entrance door secured by door entry system. All in working order at time of inspection	.		
3.2	Is there an absence of unnecessary fire load in close proximity to building?	Yes	None seen at time of inspection	.		
4	Heating Installations (Portable/fixed) Gas Installations - Common Areas & General Needs Residential flats.					
4.1	If portable heaters are used, are there suitable controls?	N/A	There are no portable heaters within the communal area.	.		
4.2	Are fixed heating installations subject to regular maintenance?	Yes	All flats have had a Gas Safety check within the last 12 months and certificates are on file.	.		
4.3	Valid LGSC held on file for each residential flat that contains gas appliances.	Yes	See 4.2	.		
5	Cooking:					
5.1	Are reasonable measures taken to prevent fires as a result of cooking?	N/A	Cooking only permitted within flats	.		
5.2	Where there is extraction ventilation in communal kitchens are filters changed/ cleaned and ductwork cleaned regularly?	N/A		.		
6	Lightning Protection System:					
6.1	Does the building have a lightning protection system, If so, is it adequately maintained?	N/A	No lightning conductor system fitted	.		
7	Housekeeping:					
7.1	Is the standard of housekeeping adequate?	No	Personal items found in hallway on ground floor HP to arrange removal	Low	19/4/26	Housing Partner
7.2	Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and residents personal items.	Yes	All checked. Some cupboards unlocked at time of inspection. These were locked by the assessor at the time.	.		
7.3	Are combustible materials separated from ignition sources and stored appropriately?	Yes	None seen at time of inspection	.		
7.4	Are unnecessary accumulations of combustible materials or waste avoided?	Yes	None seen at time of inspection	.		

7.5	Are hazardous materials stored appropriately (i.e. oxygen cylinders, flammable materials, explosive products, oxidising products, aerosols)	N/A	No evidence of hazardous materials stored on site	.		
8 Furniture/furnishings on escape routes and other communal areas:						
8.1	Furniture/furnishings in good condition, fire retardant and complies with 1988 Regulations.	N/A	Furniture not permitted in communal areas at general needs schemes	.		
9 Other Significant Fire Hazards:						
9.1	Are there other significant fire hazards that are inadequately controlled?	No	None seen at time of inspection	.		
Fire Protection Measures						
10 Means of Escape from Fire:						
10.1	Is it considered that the building is provided with reasonable means of escape in case of fire?	Yes	Single protected staircase to final exit	.		
10.2	Escape routes unobstructed and safe to use?	Yes	There were no obstructions on the means of escape at the time of inspection.	.		
10.3	Exits easily and immediately openable where necessary, without a key?	Yes	Final exit door has thumb turn on the inside	.		
10.4	Reasonable distances of travel where there is a single/alternative direction of travel?	Yes	All within acceptable limits from flat front door and within staircase.	.		
10.5	Escape routes lead to final exits and open in direction of escape where necessary?	Yes		.		
10.6	Do failsafe's on locked exit doors function correctly?	N/A	Not fitted at this scheme.	.		
10.7	Is it considered that the building is provided with reasonable arrangements for means of escape for disabled people?	Yes	Acces to main exit door from 1st and 2nd floor is via a staircase which would be unsuitable for people with certain disabilities.	.		
11 Measures to Limit Fire Spread and Development:						
11.1	Is it considered that the compartmentation is of a reasonable standard?	Yes	Compartmentation breaches observed on the last assessment have been repaired to a satisfactory standard.	.		

11.2	Is there reasonable limitation of surface finishes that might promote fire spread (walls, floors, ceilings)?	Yes		.		
11.3	Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products?	N/A	None fitted within this scheme	.		
11.4	Compartmentation within roof spaces of a satisfactory standard?	N/A	No Access to roof space from Common Area	.		
11.5	Loft hatches fire resisting?	N/A	None fitted within the communal area.	.		
11.6	Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard	N/A	No Cross Corridor Doors at this scheme	.		
11.7	Smoke Control Systems (AOV's) Are records of annual testing available?	N/A	No Automatic vents fitted at this scheme	.		
11.8	Roller shutter doors (fire resisting)	N/A	Not fitted at this scheme.	.		
11.9	Do the external walls, windows, balconies etc pose a risk of significant fire spread?	No	Standard construction	.		
12	Communal Area Fire Doors (Inspection to include - construction, hinges, closure devices, intumescent/smoke seal condition, glazing systems and maximum gaps between door and frame.					
12.1	Communal fire doors to FD30s standard and in a serviceable condition,	No	Door into lobby of Flats 25a-b smoke seal damaged and requires replacement. Door into Lobby of Flats 25c-d smoke seal partially missing and foam strip placed into rebate preventing door closing fully Work order 1362230	Low	30/4/26	Building Safety Project manager
12.2	"Fire door keep shut/locked" signage displayed on both sides of all applicable doors.	Yes	Checked	.		
12.3	Hold open devices operate at the sounding of the alarm and are in a serviceable condition	N/A	No Hold open devices at this scheme	.		
13	Flat entrance doors (Internal Common Areas)					

13.1	Do flat entrance doors open onto internal escape routes?	Yes	All appear to be in good condition	.		
14	Flats with a single direction of escape to a single escape stairway. (External Balcony)					
14.1	Do the flat entrance doors that open onto an external balcony have to be passed during an escape?	N/A	None at scheme	.		
14.2	Are the separating walls between the flats and the balcony floor that have to be passed during an escape, fire-resisting up to a height of 1.1m?	N/A	None at scheme	.		
15	Emergency Escape Lighting:					
15.1	Is the emergency lighting correctly specified and installed as per BS 5266-1:2016	Yes		.		
15.2	Are all emergency lighting units in good condition and securely fixed to walls/ceilings	Yes	All in good condition at the time of inspection.	.		
15.9	Are records of monthly testing available?	Yes	Monthly test certs uploaded to M-Files and ActiveH In date at time of inspection. Last test date : - 2nd Mar 26	.		
15.10	Are records of annual testing available?	Yes	Annual test certs uploaded to M-Files and ActiveH In date at time of inspection. Last test date : - 22nd August 25	.		
16	Fire Safety Signs and Notices:					
16.1	Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas?	Yes	The correct Notices are displayed throughout the scheme.	.		
16.3	Directional fire escape signage in place and adequate?	Yes	Checked	.		
16.4	Is there a suitable LIFT sign i.e. do not use in case of fire.	N/A	No lift present at this scheme.	.		
17	Means of giving Warning in case of Fire:					
17.1	Is the fire detection and warning system appropriate for the occupancy and fire risk?	N/A	There are no detectors within the communal area. This scheme has a stay put evacuation policy. it is unnecessary and undesirable for a communal fire alarm system to be provided.	.		

17.2	Is the fire detection and warning system correctly specified and installed as per BS 5839-1:2017	N/A		.		
17.3	Is the fire detection and warning system maintained/tested and all certificates saved on file. (BS 5839-1:2017)	N/A		.		
17.4	Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry?	N/A	Fire detection is within the flats only	.		
17.5	Is the fire alarm panel remotely monitored, and if so are there records of regular testing?	N/A	No Fire alarm Panel at this scheme	.		
17.6	Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results recorded on an in date Landlord Gas Safety Record (LGSR)	Yes	As part of Landlords gas safety check - all in date.	.		
18	Fire Extinguishing Equipment:					
18.1	Portable fire extinguishers - appropriate type/number/position?	N/A	None provided at this scheme	.		
18.2	Correct signage displayed by each fire extinguisher?	N/A		.		
18.3	Fire blanket in communal kitchen, secured to the wall, complete with signage?	N/A		.		
18.4	Hose Reels - fitted, maintained?	N/A		.		
18.5	Dry/wet risers - Full access to all inlet/outlet boxes. All inlet/outlets secured and/or securing straps fitted to outlet valves?	N/A		.		
18.6	Records available of fire fighting equipment servicing within past 12 months	N/A		.		
19	Management of Fire Safety					

19.1	Are there suitable arrangements for summoning the fire service?	Yes	Residents responsible for calling fire service	.		
19.2	Do relevant staff carry out regular fire safety checks	Yes	Housing Partners do scheme inspections. Last one 19th Jan 26	.		
19.3	Sheltered Schemes & Regional Offices - Are there sufficient number of qualified Fire wardens.	N/A	General Needs	.		
19.4	Offices - Are there suitable arrangements for ensuring the premises are evacuated?	N/A		.		
19.5	Offices - Are there suitable arrangements for evacuating disabled people?	N/A		.		
19.6	Offices - Are there suitable arrangements for meeting the fire service on arrival and providing relevant information?	N/A		.		
19.7	Offices/IL Schemes - Is there a suitable assembly point?	N/A		.		
19.8	Offices - Are fire drills carried out at appropriate intervals?	N/A		.		
20	Evacuation Policy					
20.1	Taking the findings of the FRA into account, is the evacuation policy appropriate for the scheme?	Yes	The evacuation policy is correct for this type of building. The flats were Purpose built to allow residents to stay safely within ther flats.	.		

Photographs - Fire	
05/03/2026	Moss Side A - Manor House Close



Photo No. 1	Personal items in communal hallway
-------------	------------------------------------



Photo No. 2	Smoke seal damaged on lobby door into Flats a-b
-------------	---

Photographs - Fire	
05/03/2026	Moss Side A - Manor House Close

	
Photo No. 3	Smoke seal missing from Lobby door into Flats c-d

	
Photo No. 4	Hallway Ground floor

Photographs - Fire	
05/03/2026	Moss Side A - Manor House Close

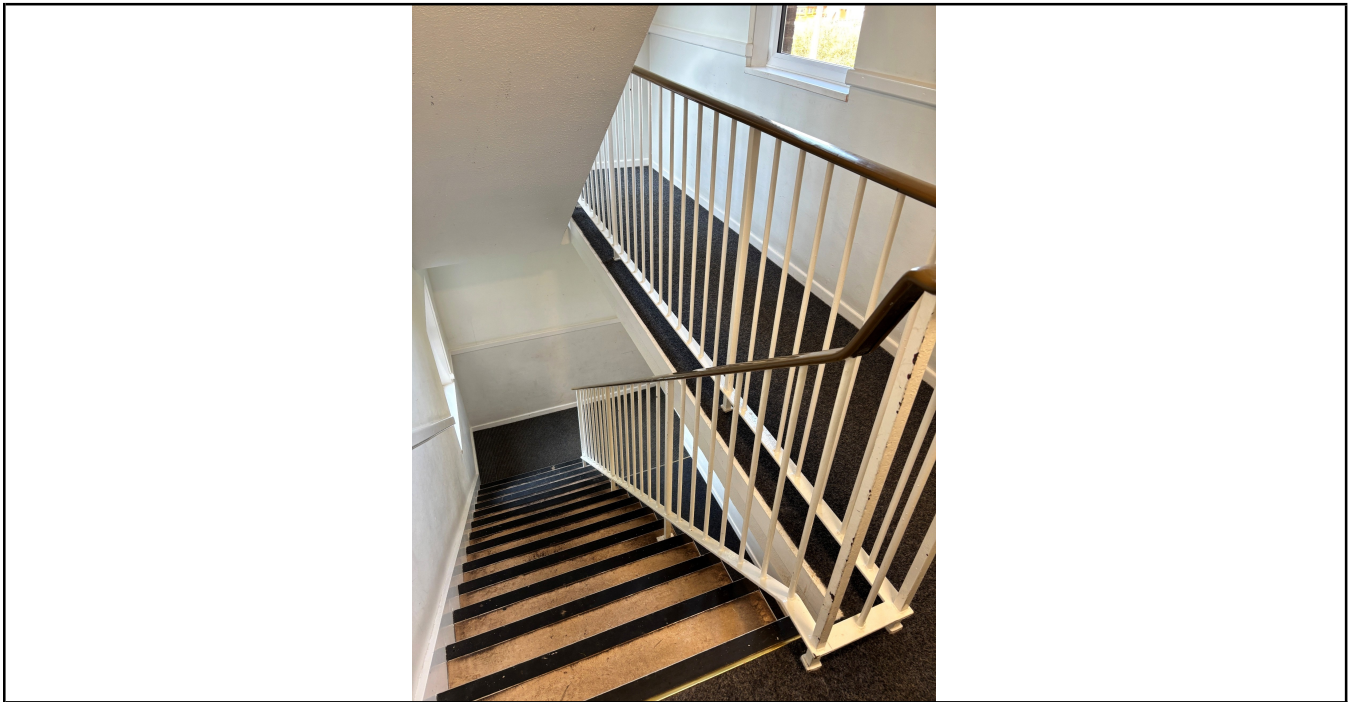


Photo No. 5	Means of escape clear between 1st and ground floors
-------------	---

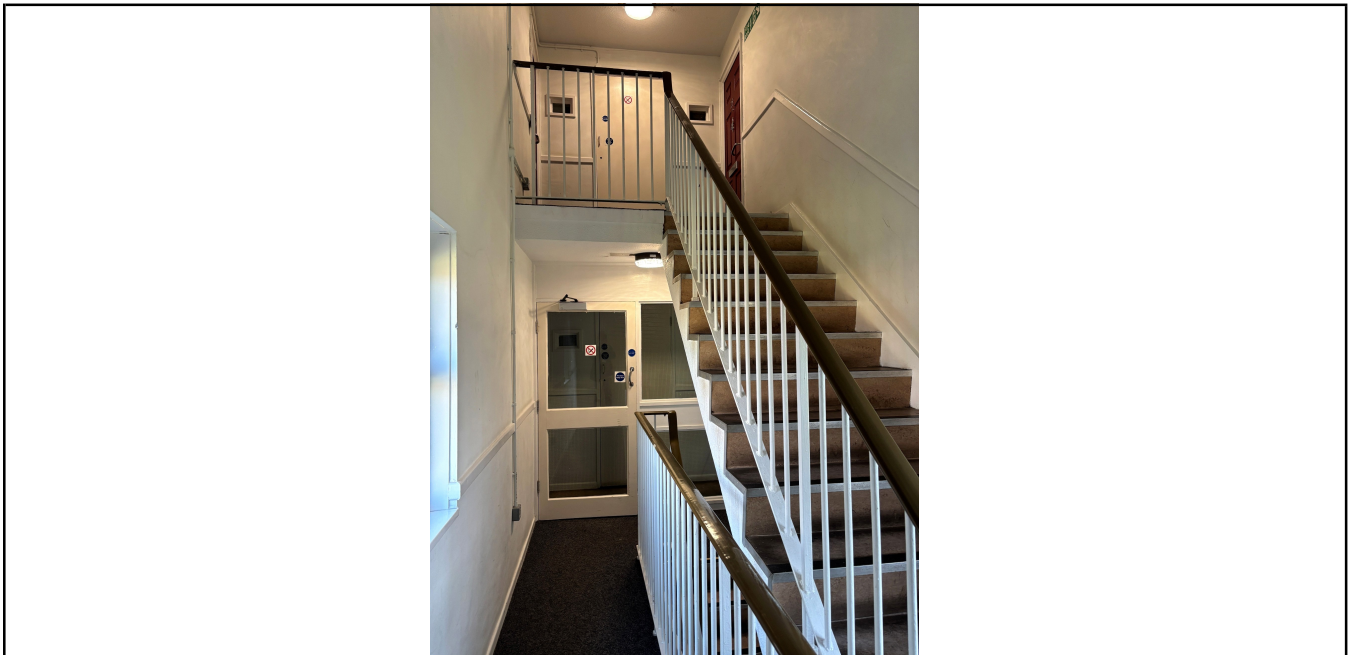


Photo No. 6	Means of escape clear between 1st and 2nd floors
-------------	--

Photographs - Fire	
05/03/2026	Moss Side A - Manor House Close



Photo No. 7	Main entrance
-------------	---------------

6. Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

(please insert x below)

LOW ☒ MEDIUM ☐ HIGH ☐

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

(please insert x below)

MINOR ☒ MAJOR ☐ CRITICAL ☐

The definition of the above terms is as follows:

FRA Review Frequency

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs).
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities.
CRITICAL	There is significant potential for serious injury or death of one or more occupants.

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

When the level of risk is established, the action level can be read from the table below:

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
Moderate	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

Action Plan - Fire					
Moss Side A - Manor House Close				05/03/2026	
Trivial					
Potential area of fire risk	Observation/Comments / Actions Required	Risk Rating	Completion Date	Referred To:	Task ID No.
Fire Hazards					
Housekeeping:					
Is the standard of housekeeping adequate?	Personal items found in hallway on ground floor HP to arrange removal	Low	19/4/26	Housing Partner	
Communal Area Fire Doors (Inspection to include - construction, closure devices, intumescent/smoke seal condition, glazing systems and					
Fire doors to FD30s standard and in a serviceable condition,	Door into lobby of Flats 25a-b smoke seal damaged and requires replacement. Door into Lobby of Flats 25c-d smoke seal partially missing and foam strip placed into rebate preventing door closing fully Work order 1362230	Low	30/4/26	Building Safety Project manager	