



ACCENT HOUSING - FIRE RISK ASSESSMENT



Region :	North West
Scheme Name :	6 Piccadilly Rd
Scheme Address :	Piccadilly Rd Burnley BB11 4QF
Date of Assessment:	13th August 26
Date of Next Assessment:	13th August 28
FRA Frequency:	2 Year Re-Assessment under the Regulatory Reform (Fire Safety) Order 2005
Fire & Safety Assessor	Ian Potter FIFireE DipFD

This Fire Risk Assessment has been conducted upon the instruction of Accent Housing.

Scheme Details		6 Piccadilly Rd
Region:		North West
Scheme Name:		6 Piccadilly Rd
Site Address:	Street:	Piccadilly Rd
	Town:	Burnley
	Post Code:	BB11 4QF
Block & Asset No.		Block 6-6a, Asset 9133
Date of this Assessment		13th August 26
Date of Next Review		13th August 28
Fire Risk Assessment Frequency		2 Years
Purpose of Fire Risk Assessment		2 Year Re-Assessment under the Regulatory Reform (Fire Safety) Order 2005
Fire & Safety Assessor		Ian Potter FIFireE DipFD
Director of Customer Experience		John Place
Housing Partner Manager		Melanie Birch
Contract Manager		Karen Anthony
Scheme Manager/Customer Partner		Kellie Boothman
Other staff in attendance		None
Use of Building		General Needs living Sleeping accommodation
Approximate Number of occupants		4
Occupancy Profile		Mixed
Familiarity of the occupants		Fully Familiar
Likely state of the Occupants		Sleeping Familiar
PEEPs in place where necessary		N/A
Number of on-site Accent staff		None
Number of other (non-Accent) staff		Contract cleaners in common areas
Support Agency (Supported Housing)		N/A
Current Evacuation Strategy.		Full (Simultaneous) Evacuation
Evidence that residents have been notified of the evacuation procedure		Fire Evacuation notices displayed in common areas and in place
History of fires in the building		None
Scope of Assessment		Type 1 (Common Parts Only - Non Destructive)
Applicable Fire Safety Guidance		LACORS Guide

Building Details	6 Piccadilly Rd
Construction Date	c1900's
Construction Type	Joisted or Load Bearing Masonry (Traditional)
Roof Finish	Pitched-Slate Tile
External Wall Finish	Stone
Are there any areas of external wall cladding	No
Are there any balconies	No
Conversion or purpose-built	Conversion
Number of flats (self-contained)/rooms (HMOS, shared houses)	2
Number of storeys above ground Not including Basements	Two
Number of storeys below ground	One
Is there a habitable basement?	No
Number of internal Staircases per Block (protected or unprotected?)	One-Protected
Number of External Staircases per Block	None
External Balcony part of escape route?	No
Unusual features	None
Building complexity	Simple
Building Access Conditions for Fire Brigade	Vehicular Access to one or more elevations
Surroundings: Residential/Commercial	Residential
Fire Provision Currently in Place	
Fire Detection and Warning System	Flats and common areas linked
Grade of fire alarm (Flats)	Grade C
Category of fire alarm (Flats)	LD2 Additional Protection
Grade of fire alarm (Communal)	Grade C
Category of fire alarm (Communal)	LD3 Minimum Protection
Additional Comments:	
Evacuation Alert System (EAS)	Not Fitted
Additional Comments:	
Emergency Lighting Provision	Non Maintained System - Common Areas
Additional Comments:	
Portable Fire Extinguishers	None fitted
Fixed Fire Fighting Installations	None fitted
Additional Comments:	

Significant Findings - Fire						
6 Piccadilly Rd				13th August 26		
Action Ref:	Potential Area of Fire Risk	Yes-No-N/A	Observation/Comments/ Actions Required	Risk Rating	Target Completion Date	Referred To:
Fire Hazards						
1	Electrical Sources of Ignition:					
1.1	Electrical Installation within common areas (Fixed Wiring, sockets, switches, light fittings) in good condition and no obvious damage	Yes	All common area sockets and fittings in a satisfactory condition at the time of inspection	.		
1.2	Valid Electrical Installation Condition Reports held on file.(Common Areas)	Yes	Valid communal area EIC Reports uploaded to property file all In date at time of inspection Last Inspection Date 30th July 26 Satisfactory	.		
1.3	Valid Electrical Installation Condition Reports held on file. (General Needs Flats)	Yes	Valid General Needs flats EIC Reports uploaded to M-Files and ActiveH. All checked and in date. Satisfactory	.		
1.4	Electrical App/PA Testing - all portable appliances tested within past 12 months	N/A	There are no portable appliances within the communal area.	.		
1.5	Absence of trailing leads and adapters	Yes	None within the communal areas	.		
1.6	Mobility Scooters - Stored/charged in common areas, purpose built store/resident flat	N/A	No evidence or reports that any of the residents own a mobility scooter	.		
2	Smoking:					
2.1	Are there any risks associated with smoking in the building?	No	Smoking is not allowed within the communal areas. Smoking is only permitted within flats. There are smoking signs present within the communal areas.	.		
3	Arson:					

3.1	Adequate security against arson?	No	Front door unlocked at time of inspection. No key safe. HP to remind residents to ensure main entrance door is kept locked.	Low	31/8/26	Housing Partner
3.2	Is there an absence of unnecessary fire load in close proximity to building?	Yes	None seen at time of inspection.	.		
4	Heating Installations (Portable/fixed) Gas Installations - Common Areas & General Needs Residential flats.					
4.1	If portable heaters are used, are there suitable controls?	N/A	There are no portable heaters within the communal area.	.		
4.2	Are fixed heating installations subject to regular maintenance?	Yes	No communal heating - gas supply to flats is tested and in date.	.		
4.3	Valid LGSC held on file for each residential flat that contains gas appliances.	Yes	All checked and in date.	.		
5	Cooking:					
5.1	Are reasonable measures taken to prevent fires as a result of cooking?	N/A	Cooking only permitted within flats	.		
5.2	Where there is extraction ventilation in communal kitchens are filters changed/ cleaned and ductwork cleaned regularly?	N/A	No communal kitchen	.		
6	Lightning Protection System:					
6.1	Does the building have a lightning protection system, If so, is it adequately maintained?	N/A	No lightning conductor system fitted	.		
7	Housekeeping:					
7.1	Is the standard of housekeeping adequate?	No	Small amount of paper 'flyers' in the electrical cupboard. Otherwise all ok. HP to be informed	Low	31/8/26	Housing Partner

7.2	Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and residents personal items.	No	Electrical cupboard doors will not close due to Gas meter pressing on door. This was reported 2 years ago and is still in the same state. Discussed with Accent Gas Project Manager and the whole installation needs to be assessed for compliance including the compliance of the cupboard doors which dont have vents fitted. Work order 1399548 raised for Gas contractor to attend and assess the installation.	Med	19/8/26	Building Safety Project manager
7.3	Are combustible materials separated from ignition sources and stored appropriately?	No	See 7.1	.		
7.4	Are unnecessary accumulations of combustible materials or waste avoided?	No	See 7.1	.		
7.5	Are hazardous materials stored appropriately (i.e. oxygen cylinders, flammable materials, explosive products, oxidising products, aerosols)	N/A	No evidence of hazardous materials stored on site	.		
8	Furniture/furnishings on escape routes and other communal areas:					
8.1	Furniture/furnishings in good condition, fire retardant and complies with 1988 Regulations.	N/A	Furniture not permitted in communal areas at general needs schemes	.		
9	Other Significant Fire Hazards:					
9.1	Are there other significant fire hazards that are inadequately controlled?	Yes	See 7.2 in relation to gas meter installation.	.		
Fire Protection Measures						
10	Means of Escape from Fire:					
10.1	Is it considered that the building is provided with reasonable means of escape in case of fire?	Yes	Single staircase leading to small lobby and front door.	.		
10.2	Escape routes unobstructed and safe to use?	Yes	There were no obstructions on the means of escape at the time of inspection.	.		
10.3	Exits easily and immediately openable where necessary, without a key?	Yes	Thumbturn on the inside of the main exit door.	.		

10.4	Reasonable distances of travel where there is a single/alternative direction of travel?	Yes	All within reasonable tolerances.	.		
10.5	Escape routes lead to final exits and open in direction of escape where necessary?	Yes	Doors open inwards which is acceptable for these premises	.		
10.6	Do failsafe's on locked exit doors function correctly?	N/A	None fitted	.		
10.7	Is it considered that the building is provided with reasonable arrangements for means of escape for disabled people?	Yes	Ground floor only	.		
11	Measures to Limit Fire Spread and Development:					
11.1	Is it considered that the compartmentation is of a reasonable standard?	No	Unable to access the basement which is located within the ground floor flat. However access was gained to No8 next door which is identical. The basement extends under the communal hallway and does not have adequate fire separation between the basement and the ground floor. Contractor to attend and install 30 min fire separation. Work Order 1400851	Med	30/9/26	Building Safety Project manager
11.2	Is there reasonable limitation of surface finishes that might promote fire spread (walls, floors, ceilings)?	Yes	Reasonable limitation with communal area	.		
11.3	Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products?	N/A	None fitted within this scheme	.		
11.4	Compartmentation within roof spaces of a satisfactory standard?	N/A	No Access to roof space from Common Area	.		
11.5	Loft hatches fire resisting?	N/A	None fitted within the communal area.	.		
11.6	Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard	N/A	No Cross Corridor Doors at this scheme	.		
11.7	Smoke Control Systems (AOV's) Are records of annual testing available?	N/A	No Automatic vents fitted at this scheme	.		

11.8	Roller shutter doors (fire resisting)	N/A	Not fitted at this scheme.	.		
11.9	Do the external walls, windows, balconies etc pose a risk of significant fire spread?	No	Standard construction	.		
12	Communal Area Fire Doors (Inspection to include - construction, hinges, closure devices, intumescent/smoke seal condition, glazing systems and maximum gaps between door and frame.					
12.1	Communal fire doors to FD30s standard and in a serviceable condition,	Yes	There are no communal fire doors within this block.	.		
12.2	"Fire door keep shut/locked" signage displayed on both sides of all applicable doors.	Yes	Checked	.		
12.3	Hold open devices operate at the sounding of the alarm and are in a serviceable condition	N/A	No Hold open devices at this scheme	.		
13	Flat entrance doors (Internal Common Areas)					
13.1	Do flat entrance doors open onto internal escape routes?	Yes	Both appear to be in good condition.	.		
14	Flats with a single direction of escape to a single escape stairway. (External Balcony)					
14.1	Do the flat entrance doors that open onto an external balcony have to be passed during an escape?	N/A	None at this scheme	.		
14.2	Are the separating walls between the flats and the balcony floor that have to be passed during an escape, fire-resisting up to a height of 1.1m?	N/A	None at this scheme	.		
15	Emergency Escape Lighting:					
15.1	Is the emergency lighting correctly specified and installed as per BS 5266-1:2016	Yes		.		
15.2	Are all emergency lighting units in good condition and securely fixed to walls/ceilings	Yes	All in good condition at the time of inspection.	.		
15.9	Are records of monthly testing available?	Yes	Monthly test certs uploaded to M-Files and ActiveH In date at time of inspection. Last test date : - 10th Aug 26	.		

15.10	Are records of annual testing available?	Yes	Annual test certs uploaded to M-Files and ActiveH In date at time of inspection. Last test date : - 21st May 26	.		
16	Fire Safety Signs and Notices:					
16.1	Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas?	Yes	The correct Notices are displayed throughout the scheme.	.		
16.3	Directional fire escape signage in place and adequate?	N/A	Not required - due to layout of premises	.		
16.4	Is there a suitable LIFT sign i.e. do not use in case of fire.	N/A	No lift present at this scheme.	.		
17	Means of giving Warning in case of Fire:					
17.1	Is the fire detection and warning system appropriate for the occupancy and fire risk?	Yes	In accordance with Lacors guidance	.		
17.2	Is the fire detection and warning system correctly specified and installed as per BS 5839-1:2017	Yes	Detection linked to communal panel	.		
17.3	Is the fire detection and warning system maintained/tested and all certificates saved on file. (BS 5839-1:2017)	Yes	Last recorded test date : 21st May 26	.		
17.4	Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry?	N/A	None at this scheme	.		
17.5	Is the fire alarm panel remotely monitored, and if so are there records of regular testing?	N/A	There is a fire panel at this scheme but it is not remotley monitored.	.		
17.6	Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results recorded on an in date Landlord Gas Safety Record (LGSR)	Yes	Checked and recorded on each report	.		
18	Fire Extinguishing Equipment:					
18.1	Portable fire extinguishers - appropriate type/number/position?	N/A	None at this scheme	.		

18.2	Correct signage displayed by each fire extinguisher?	N/A	None at this scheme	.		
18.3	Fire blanket in communal kitchen, secured to the wall, complete with signage?	N/A	None at this scheme	.		
18.4	Hose Reels - fitted, maintained?	N/A	None at this scheme	.		
18.5	Dry/wet risers - Full access to all inlet/outlet boxes. All inlet/outlets secured and/or securing straps fitted to outlet valves?	N/A	None at this scheme	.		
18.6	Records available of fire fighting equipment servicing within past 12 months	N/A	None at this scheme	.		
19	Management of Fire Safety					
19.1	Are there suitable arrangements for summoning the fire service?	Yes	Residents responsible for calling fire service	.		
19.2	Do relevant staff carry out regular fire safety checks	Yes	Housing Partners do scheme inspections.	.		
19.3	Sheltered Schemes & Regional Offices - Are there sufficient number of qualified Fire wardens.	N/A	General needs scheme	.		
19.4	Offices - Are there suitable arrangements for ensuring the premises are evacuated?	N/A	General needs scheme	.		
19.5	Offices - Are there suitable arrangements for evacuating disabled people?	N/A	General needs scheme	.		
19.6	Offices - Are there suitable arrangements for meeting the fire service on arrival and providing relevant information?	N/A	General needs scheme	.		
19.7	Offices/IL Schemes - Is there a suitable assembly point?	N/A	General needs scheme	.		
19.8	Offices - Are fire drills carried out at appropriate intervals?	N/A	General needs scheme	.		
20	Evacuation Policy					

20.1	Taking the findings of the FRA into account, is the evacuation policy appropriate for the scheme?	Yes	The evacuation policy is correct for this type of building. The flats were Purpose built to allow residents to stay safely within ther flats. A reassessment will be carried out after the third party survey results.	.		
------	---	-----	--	---	--	--

Photographs - Fire

13th August 26

6 Piccadilly Rd

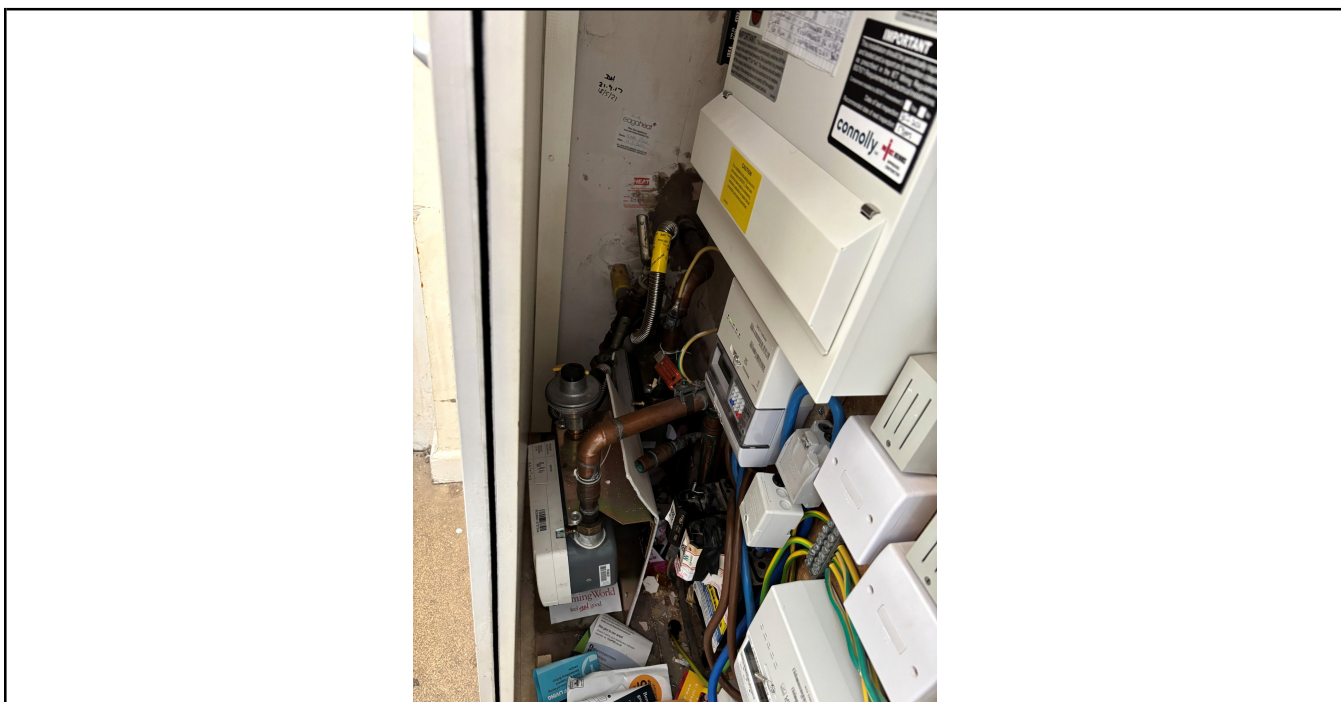


Photo No. 1

Gas meter installation requires inspection for compliance



Photo No. 2

Gas meter resting on doors and preventing doors closing- No vents

Photographs - Fire	
13th August 26	6 Piccadilly Rd

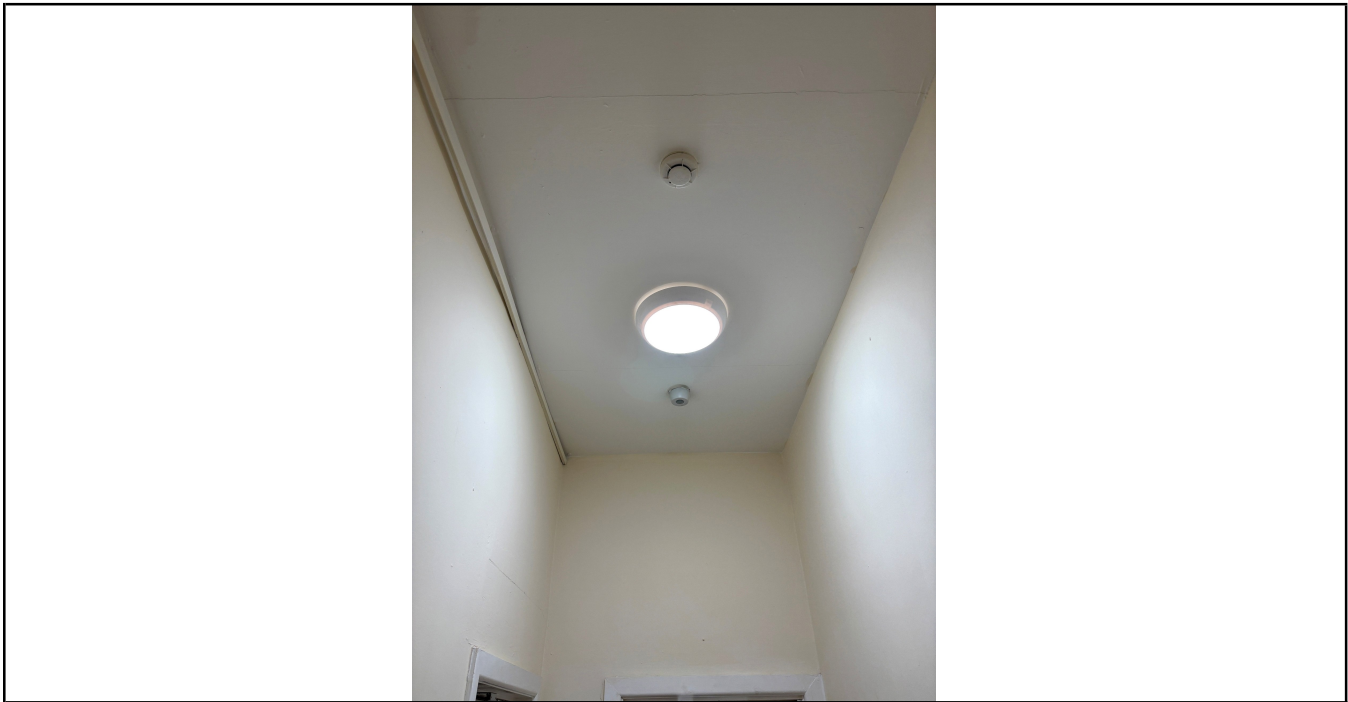


Photo No. 3	Detection and Emergency lighting in hallway
-------------	---



Photo No. 4	Fire panel showing no faults
-------------	------------------------------

Photographs - Fire	
13th August 26	6 Piccadilly Rd



Photo No. 5	Fire separation in basement (picture from Flat 8)
-------------	---



Photo No. 6	Fire separation in basement (picture from Flat 8)
-------------	---

6. Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

(please insert x below)

LOW ☒ MEDIUM ☐ HIGH ☐

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

(please insert x below)

MINOR ☐ MAJOR ☒ CRITICAL ☐

The definition of the above terms is as follows:

FRA Review Frequency

MINOR	Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs).
MAJOR	An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities.
CRITICAL	There is significant potential for serious injury or death of one or more occupants.

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

Fire Hazard	Minor	Major	Critical
Low	Trivial	Tolerable	Moderate
Medium	Tolerable	Moderate	Substantial
High	Moderate	Substantial	Intolerable

When the level of risk is established, the action level can be read from the table below:

Risk Level	Guide to actions and appropriate timescales
Trivial	No action is required
Moderate	Efforts should be made to reduce the risk level and this should be carried out within the specified time periods.
Substantial	Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is
Intolerable	The building (or the relevant area) should not be occupied until the risk is reduced.

Action Plan - Fire					
6 Piccadilly Rd			13th August 26		
Tolerable					
Potential area of fire risk	Observation/Comments / Actions Required	Risk Rating	Completion Date	Referred To:	Task ID No.
Fire Hazards					
Arson:					
Adequate security against arson?	Front door unlocked at time of inspection. No key safe. HP to remind residents to ensure main entrance door is kept locked.	Low	31/08/26	Housing Partner	2174283
Housekeeping:					
Is the standard of housekeeping adequate?	Small amount of paper 'flyers' in the electrical cupboard. Otherwise all ok. HP to be informed	Low	31/08/26	Housing Partner	2174283
Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and residents personal items.	Electrical cupboard doors will not close due to Gas meter pressing on door. This was reported 2 years ago and is still in the same state. Discussed with Accent Gas Project Manager and the whole installation needs to be assessed for compliance including the compliance of the cupboard doors which dont have vents fitted. Work order 1399548 raised for Gas contractor to attend and assess the installation.	Med	19/08/26	Building Safety Project manager	
Measures to Limit Fire Spread and Development:					
Is it considered that the compartmentation is of a reasonable standard?	Unable to access the basement which is located within the ground floor flat. However access was gained to No8 next door which is identical. The basement extends under the communal hallway and does not have adequate fire separation between the basement and the ground floor. Contractor to attend and install 30 min fire separation. Work Order 1400851	Med	30/09/26	Building Safety Project manager	