



ACCENT HOUSING - FIRE RISK ASSESSMENT



| | |
|-----------------------------------|--|
| Region : | South |
| Scheme Name : | Orchard Court |
| Scheme Address : | 1-17 Orchard Court, Orchard Way Camberley GU15 2TH |
| Date of Assessment: | 21/01/2026 |
| Date of Next Assessment: | 21/01/2027 |
| FRA Frequency: | Annual Re-Assessment under the Regulatory Reform (Fire Safety) Order 2005 |
| Fire & Safety Assessor | Gary Bredin AIFireE DipFD |

This Fire Risk Assessment has been conducted upon the instruction of Accent Housing.

| Scheme Details | | Orchard Court |
|---|---|---------------------------------|
| Region: | South | |
| Scheme Name: | Orchard Court | |
| Site Address: | Street: | 1-17 Orchard Court, Orchard Way |
| | Town: | Camberley |
| | Post Code: | GU15 2TH |
| Block & Asset No. | Block 1-17 Asset No.25173 | |
| Date of this Assessment | 21/01/2026 | |
| Date of Next Review | 21/01/2027 | |
| Fire Risk Assessment Frequency | Annual | |
| Purpose of Fire Risk Assessment | Annual Re-Assessment under the Regulatory Reform (Fire Safety) Order 2005 | |
| Fire & Safety Assessor | Gary Bredin AIFireE DipFD | |
| Director of Customer Experience | Position Vacant | |
| Housing Partner Manager | Tracy Wilkinson | |
| Contract Manager | Adam Rickard. | |
| Scheme Manager/Customer Partner | Paul Hudson | |
| Other staff in attendance | None | |
| Use of Building | Category 2 Independent Living | |
| Approximate Number of occupants | 20+ | |
| Occupancy Profile | Elderly | |
| Familiarity of the occupants | Fully Familiar | |
| Likely state of the Occupants | Alert | |
| PEEPs in place where necessary | Records maintained by Scheme Manager | |
| Number of on-site Accent staff | None | |
| Number of other (non-Accent) staff | Contract cleaners in common areas | |
| Support Agency (Supported Housing) | N/A | |
| Current Evacuation Strategy. | Dual system Communal full evacuation flats stay put(Stay Safe) | |
| Evidence that residents have been notified of the evacuation procedure | Fire Evacuation notices displayed in common areas and in place | |
| History of fires in the building | None | |
| Scope of Assessment | Type 1 (Common Parts Only - Non Destructive) | |
| Applicable Fire Safety Guidance | Specialised housing guide | |
| | | |
| | | |
| | | |

| Building Details | Orchard Court |
|--|--|
| Construction Date | Concrete Frame |
| Construction Type | |
| Roof Finish | Flat-Felt |
| External Wall Finish | |
| Are there any areas of external wall cladding | No |
| Are there any balconies | No |
| Conversion or purpose-built | Purpose Built |
| Number of flats (self-contained)/rooms (HMOS, shared houses) | 17 self contained flats |
| Number of storeys above ground Not including Basements | Two |
| Number of storeys below ground | None |
| Is there a habitable basement? | No |
| Number of internal Staircases per Block (protected or unprotected?) | One-Protected |
| Number of External Staircases per Block | One |
| External Balcony part of escape route? | Yes |
| Unusual features | All flat entrance doors open into fresh air. 1st floor flats accessed by balconies |
| Building complexity | Simple |
| Building Access Conditions for Fire Brigade | Vehicular Access to one or more elevations |
| Surroundings: Residential/Commercial | Residential |
| Fire Provision Currently in Place | |
| Fire Detection and Warning System | Flats and common areas linked |
| Grade of fire alarm (Flats) | Grade D |
| Category of fire alarm (Flats) | LD2 Additional Protection |
| Grade of fire alarm (Communal) | Grade D |
| Category of fire alarm (Communal) | LD2 Additional Protection |
| Evacuation Alert System (EAS) | Not Fitted |
| Emergency Lighting Provision | Non Maintained System - Common Areas |
| Additional Comments: | |
| Portable Fire Extinguishers | Foam |
| | Carbon Dioxide |
| | |
| | |
| Additional Comments: | |
| Fixed Fire Fighting Installations | None fitted |
| Additional Comments: | |

| Significant Findings - Fire | | | | | | |
|-----------------------------|---|------------|--|-------------|------------------------|--------------|
| Orchard Court | | | | | 21/01/2026 | |
| Action Ref: | Potential Area of Fire Risk | Yes-No-N/A | Observation/Comments/ Actions Required | Risk Rating | Target Completion Date | Referred To: |
| Fire Hazards | | | | | | |
| 1 | Electrical Sources of Ignition: | | | | | |
| 1.1 | Electrical Installation within common areas (Fixed Wiring, sockets, switches, light fittings) in good condition and no obvious damage | Yes | All common area sockets and fittings in a satisfactory condition at the time of inspection | . | | |
| 1.2 | Valid Electrical Installation Condition Reports held on file.(Common Areas) | Yes | Valid communal area EIC Reports uploaded to property file all In date at time of inspection Last Inspection Date 24th January 2024 | . | | |
| 1.3 | Valid Electrical Installation Condition Reports held on file. (General Needs Flats) | Yes | Valid General Needs flats EIC Reports uploaded to M-Files and ActiveH. | . | | |
| 1.4 | Electrical App/PA Testing - all portable appliances tested within past 12 months | Yes | Last test date 13/12 2025 | . | | |
| 1.5 | Absence of trailing leads and adapters | Yes | None within the communal areas | . | | |
| 1.6 | Mobility Scooters - Stored/charged in common areas, purpose built store/resident flat | N/A | No evidence or reports that any of the residents own a mobility scooter | . | | |
| 2 | Smoking: | | | | | |
| 2.1 | Are there any risks associated with smoking in the building? | No | Smoking is not allowed within the communal areas. Smoking is only permitted within flats. There are smoking signs present within the communal areas. | . | | |
| 3 | Arson: | | | | | |
| 3.1 | Adequate security against arson? | Yes | Communal areas are locked whilst not in use | . | | |
| 3.2 | Is there an absence of unnecessary fire load in close proximity to building? | Yes | | . | | |

| | | | | | |
|----------|---|-----|---|---|--|
| 4 | Heating Installations (Portable/fixed) Gas Installations - Common Areas & General Needs Residential flats. | | | | |
| 4.1 | If portable heaters are used, are there suitable controls? | N/A | There are no portable heaters within the communal area. | . | |
| 4.2 | Are fixed heating installations subject to regular maintenance? | Yes | Gas safety for main boilers and lounge boiler uploaded to M Files. | . | |
| 4.3 | Valid LGSC held on file for each residential flat that contains gas appliances. | N/A | No gas supply to the flats. | . | |
| 5 | Cooking: | | | | |
| 5.1 | Are reasonable measures taken to prevent fires as a result of cooking? | N/A | Cooking only permitted within flats | . | |
| 5.2 | Where there is extraction ventilation in communal kitchens are filters changed/ cleaned and ductwork cleaned regularly? | N/A | | . | |
| 6 | Lightning Protection System: | | | | |
| 6.1 | Does the building have a lightning protection system, If so, is it adequately maintained? | N/A | No lightning conductor system fitted | . | |
| 7 | Housekeeping: | | | | |
| 7.1 | Is the standard of housekeeping adequate? | Yes | Regular inspections by Scheme Manager | . | |
| 7.2 | Are all electrical/intake/service cupboards secure and free from general waste, contractors waste and residents personal items. | Yes | All cupboards secure and clear at time of inspection | . | |
| 7.3 | Are combustible materials separated from ignition sources and stored appropriately? | Yes | | . | |
| 7.4 | Are unnecessary accumulations of combustible materials or waste avoided? | Yes | | . | |
| 7.5 | Are hazardous materials stored appropriately (i.e. oxygen cylinders, flammable materials, explosive products, oxidising products, aerosols) | Yes | Cleaning materials stored in a room secured by a fire door. | . | |
| 8 | Furniture/furnishings on escape routes and other communal areas: | | | | |
| 8.1 | Furniture/furnishings in good condition, fire retardant and complies with 1988 Regulations. | Yes | All furniture is new and its believed that it complies to the latest standards. | . | |

| 9 Other Significant Fire Hazards: | | | | | |
|---|---|-----|--|---|--|
| 9.1 | Are there other significant fire hazards that are inadequately controlled? | No | | . | |
| Fire Protection Measures | | | | | |
| 10 Means of Escape from Fire: | | | | | |
| 10.1 | Is it considered that the building is provided with reasonable means of escape in case of fire? | Yes | Final exit doors in all flats on the means of escape are FD30s and conforming to the latest British Standard. | . | |
| 10.2 | Escape routes unobstructed and safe to use? | Yes | Some residents have flowers in ceramic pots outside there doors on the balconies. These are permitted as long as the gap between them and the wall opposite isn't less than 1mtr. Schemes partner to monitor | . | |
| 10.3 | Exits easily and immediately openable where necessary, without a key? | Yes | All exit doors are of the push bar, push pad or thumb turn type signage updated during the inspection. | . | |
| 10.4 | Reasonable distances of travel where there is a single/alternative direction of travel? | Yes | | . | |
| 10.5 | Escape routes lead to final exits and open in direction of escape where necessary? | Yes | | . | |
| 10.6 | Do failsafe's on locked exit doors function correctly? | N/A | All doors manual operation | . | |
| 10.7 | Is it considered that the building is provided with reasonable arrangements for means of escape for disabled people? | No | Ground floor areas only are suitable for disabled access/egress. | . | |
| 11 Measures to Limit Fire Spread and Development: | | | | | |
| 11.1 | Is it considered that the compartmentation is of a reasonable standard? | Yes | | . | |
| 11.2 | Is there reasonable limitation of surface finishes that might promote fire spread (walls, floors, ceilings)? | Yes | | . | |
| 11.3 | Are fire dampers/shutters provided in ducts/refuse chutes to protect means of escape against fire, smoke and combustion products? | N/A | None fitted within this scheme | . | |

| | | | | | | |
|-----------|--|-----|---|---|--|--|
| 11.4 | Compartmentation within roof spaces of a satisfactory standard? | N/A | Flat roof construction. No access to any roof voids | . | | |
| 11.5 | Loft hatches fire resisting? | N/A | None fitted within the communal area. | . | | |
| 11.6 | Fire stopping above cross-corridor fire doors within suspended ceiling void of a satisfactory standard | N/A | No Cross Corridor Doors at this scheme | . | | |
| 11.7 | Smoke Control Systems (AOV's) Are records of annual testing available? | N/A | No Automatic vents fitted at this scheme | . | | |
| 11.8 | Roller shutter doors (fire resisting) | N/A | Not fitted at this scheme. | . | | |
| 11.9 | Do the external walls, windows, balconies etc pose a risk of significant fire spread? | No | | . | | |
| 12 | Communal Area Fire Doors (Inspection to include - construction, hinges, closure devices, intumescent/smoke seal condition, glazing systems and maximum gaps between door and frame. | | | | | |
| 12.1 | Communal fire doors to FD30s standard and in a serviceable condition, | Yes | All communal fire doors were found to be in good condition and conforming to the latest British Standard. | . | | |
| 12.2 | "Fire door keep shut/locked" signage displayed on both sides of all applicable doors. | Yes | Some signs were missing and were replaced/updated during the inspection. | . | | |
| 12.3 | Hold open devices operate at the sounding of the alarm and are in a serviceable condition | N/A | No Hold open devices at this scheme | . | | |
| 13 | Flat entrance doors (Internal Common Areas) | | | | | |
| 13.1 | Do flat entrance doors open onto internal escape routes? | Yes | | . | | |
| 14 | Flats with a single direction of escape to a single escape stairway. (External Balcony) | | | | | |
| 14.1 | Do the flat entrance doors that open onto an external balcony have to be passed during an escape? | N/A | | . | | |
| 14.2 | Are the separating walls between the flats and the balcony floor that have to be passed during an escape, fire-resisting up to a height of 1.1m? | N/A | | . | | |
| 15 | Emergency Escape Lighting: | | | | | |

| | | | | | | |
|-----------|---|-----|--|---|--|--|
| 15.1 | Is the emergency lighting correctly specified and installed as per BS 5266-1:2016 | Yes | Non-maintained emergency lighting is installed within all escape routes | ' | | |
| 15.2 | Are all emergency lighting units in good condition and securely fixed to walls/ceilings | Yes | All in good condition at the time of inspection. | ' | | |
| 15.9 | Are records of monthly testing available? | Yes | Monthly test certs uploaded to M-Files and ActiveH | ' | | |
| 15.10 | Are records of annual testing available? | Yes | Annual test certs uploaded to M-Files and ActiveH In date at time of inspection. Last test date : - 4/6/2025 | ' | | |
| 16 | Fire Safety Signs and Notices: | | | | | |
| 16.1 | Are the correct Fire Action/Advice notices displayed in prominent locations within the common areas? | Yes | The correct Notices are displayed throughout the scheme. | ' | | |
| 16.3 | Directional fire escape signage in place and adequate? | Yes | Signage checked and updated during inspection | ' | | |
| 16.4 | Is there a suitable LIFT sign i.e. do not use in case of fire. | Yes | Only a stair lift is present at this scheme. | ' | | |
| 17 | Means of giving Warning in case of Fire: | | | | | |
| 17.1 | Is the fire detection and warning system appropriate for the occupancy and fire risk? | Yes | | ' | | |
| 17.2 | Is the fire detection and warning system correctly specified and installed as per BS 5839-1:2017 | Yes | | ' | | |
| 17.3 | Is the fire detection and warning system maintained/tested and all certificates saved on file. (BS 5839-1:2017) | Yes | | ' | | |
| 17.4 | Are there heat detectors located in the Kitchen, Boiler, Plant Room and Laundry? | Yes | Heat detection in the boiler room. | ' | | |
| 17.5 | Is the fire alarm panel remotely monitored, and if so are there records of regular testing? | Yes | Fire alarm monitored by Astraline when scheme manager is not on the premises. Warden call contract with Tunstall | ' | | |

| | | | | | | |
|-----------|--|-----|---|---|--|--|
| 17.6 | Are smoke/heat detectors within General Needs flats subject to an annual inspection and the results recorded on an in date Landlord Gas Safety Record (LGSR) | Yes | There is no gas supply to the flats so a contract is in place with Tunstall to annually test the detection within each flat. | ' | | |
| 18 | Fire Extinguishing Equipment: | | | | | |
| 18.1 | Portable fire extinguishers - appropriate type/number/position? | Yes | All testing was in date. | ' | | |
| 18.2 | Correct signage displayed by each fire extinguisher? | Yes | | ' | | |
| 18.3 | Fire blanket in communal kitchen, secured to the wall, complete with signage? | Yes | | ' | | |
| 18.4 | Hose Reels - fitted, maintained? | N/A | | ' | | |
| 18.5 | Dry/wet risers - Full access to all inlet/outlet boxes. All inlet/outlets secured and/or securing straps fitted to outlet valves? | N/A | | ' | | |
| 18.6 | Records available of fire fighting equipment servicing within past 12 months | Yes | Last test date 7/1/2025 | ' | | |
| 19 | Management of Fire Safety | | | | | |
| 19.1 | Are there suitable arrangements for summoning the fire service? | Yes | Residents responsible for calling fire service. Fire alarm monitored by Astraline when scheme manager is not on the premises. | ' | | |
| 19.2 | Do relevant staff carry out regular fire safety checks | Yes | Housing Partners do scheme inspections. | ' | | |
| 19.3 | Sheltered Schemes & Regional Offices - Are there sufficient number of qualified Fire wardens. | N/A | | ' | | |
| 19.4 | Offices - Are there suitable arrangements for ensuring the premises are evacuated? | N/A | | ' | | |
| 19.5 | Offices - Are there suitable arrangements for evacuating disabled people? | N/A | | ' | | |
| 19.6 | Offices - Are there suitable arrangements for meeting the fire service on arrival and providing relevant information? | N/A | | ' | | |

| | | | | | | |
|-----------|---|-----|--|---|--|--|
| 19.7 | Offices/IL Schemes - Is there a suitable assembly point? | Yes | Assembly point designated by signage | . | | |
| 19.8 | Offices - Are fire drills carried out at appropriate intervals? | N/A | | . | | |
| 20 | Evacuation Policy | | | | | |
| 20.1 | Taking the findings of the FRA into account, is the evacuation policy appropriate for the scheme? | Yes | The evacuation policy is correct for this type of building. The flats were Purpose built to allow residents to stay safely within ther flats. A reassessment will be carried out after the third party survey results. | . | | |

Photographs - Fire

21/01/2026

Orchard Court

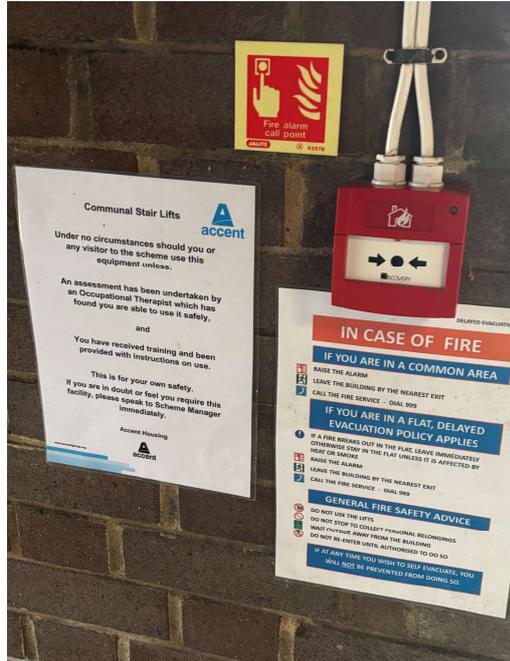


Photo No. 1

Evacuation policy posted throughout the scheme.



Photo No. 2

No faults showing on the alarm panel.

Photographs - Fire

21/01/2026

Orchard Court

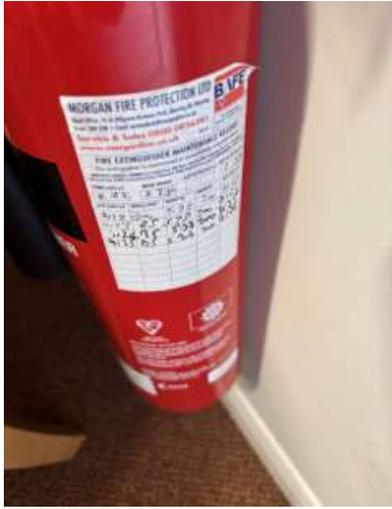


Photo No. 3

All fire extinguishers were within test date.



Photo No. 4

Recent compartmentation works have been carried out in the boiler room.

Photographs - Fire

21/01/2026

Orchard Court

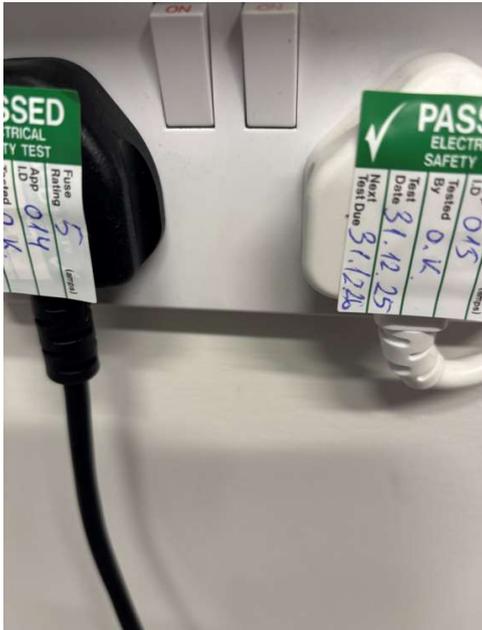


Photo No. 5

All items have been PA Tested and are in date.

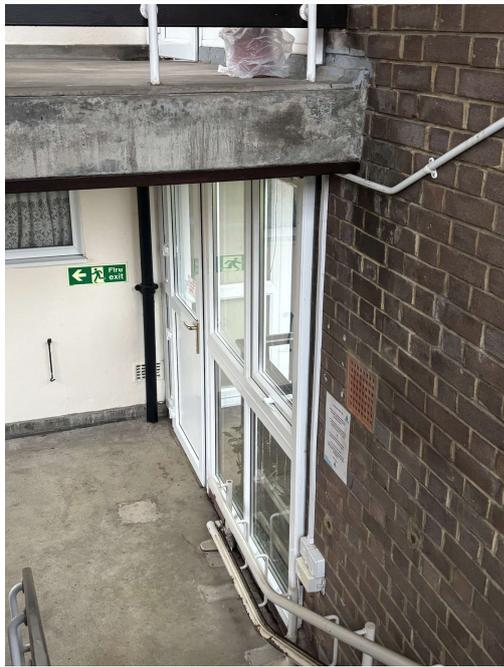


Photo No. 6

All areas were clear at the time of the audit.

Photographs - Fire

21/01/2026

Orchard Court



Photo No. 7

Filters in the tumble driers require regular cleaning. HP Dealing.



Photo No. 8

Bolts to be removed from the doors. Requires single action lock only.

Photographs - Fire

21/01/2026

Orchard Court

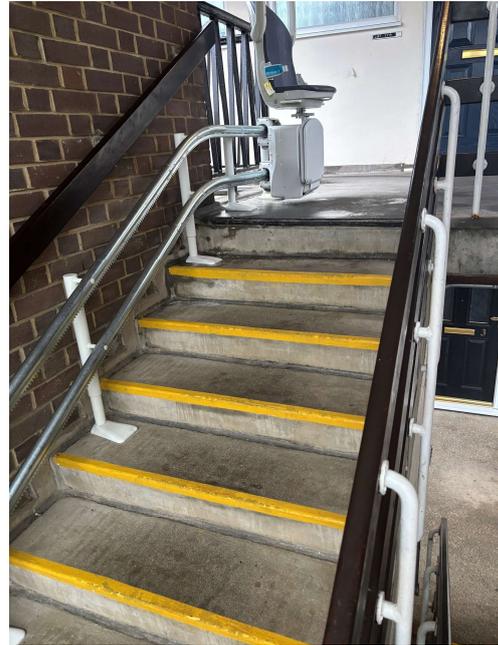


Photo No. 9

Stairlift on site with associated users guide.

6. Risk Calculator - Fire

The following risk estimator is based on the general health and safety risk level estimator contained within BS 8800: 1996. Guide to occupational health and safety management systems.

1. Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from the fire (the probability of ignition) at this building is:

(please insert x below)

LOW MEDIUM HIGH

2. Taking into account the nature of the building, the occupants, the fire protection afforded and any procedural arrangements observed at the time of the assessment, it is considered that the consequences for life safety in the event of a fire would be:

(please insert x below)

MINOR MAJOR CRITICAL

The definition of the above terms is as follows:
FKA Review Frequency

| | |
|-----------------|---|
| MINOR | Outbreak of fire is unlikely to result in serious injury or death of any occupant (other than the occupant sleeping in a bedroom in which a fire occurs). |
| MAJOR | An outbreak of fire could result in injury of one or more occupants, but is unlikely to lead to fatalities. |
| CRITICAL | There is significant potential for serious injury or death of one or more occupants. |

3. The above estimates are then read into the following matrix table to give the overall risk level for the site:

| Fire Hazard | Minor | Major | Critical |
|-------------|-----------|-------------|-------------|
| Low | Trivial | Tolerable | Moderate |
| Medium | Tolerable | Moderate | Substantial |
| High | Moderate | Substantial | Intolerable |

When the level of risk is established, the action level can be read from the table below:

| Risk Level | Guide to actions and appropriate timescales |
|-------------|---|
| Trivial | No action is required |
| Moderate | Efforts should be made to reduce the risk level and this should be carried out within the specified time periods. |
| Substantial | Considerable resources may have to be allocated to reduce the risk level. It may be necessary to limit the occupation of some parts until urgent remedial action is |
| Intolerable | The building (or the relevant area) should not be occupied until the risk is reduced. |